



Set Configuration: Metric

Full set

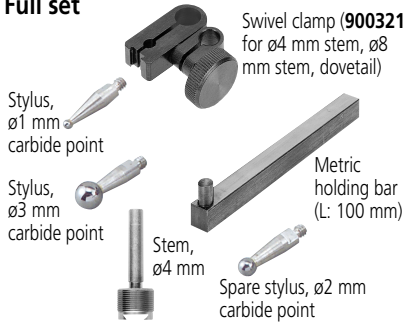


Basic set

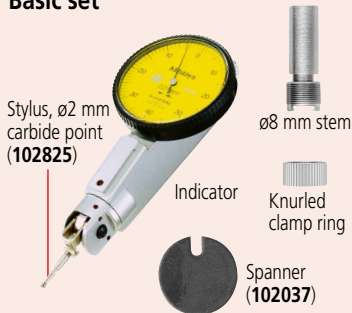


Set Configuration: Inch

Full set

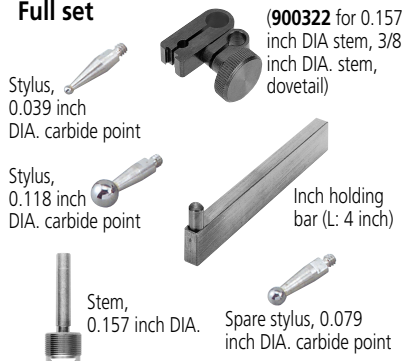

Basic set

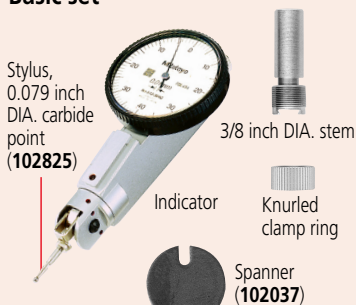


Optional Accessories

- : Swivel clamps (See page F-69)
- : Holding bars (See page F-69)
- : Stems (See page F-69)
- 102824:** Stylus, ø1 mm ball contact (carbide)
- 102825:** Stylus, ø2 mm ball contact (carbide)
- 102826:** Stylus, ø3 mm ball contact (carbide)



Dial Test Indicator SERIES 513 — Universal Type

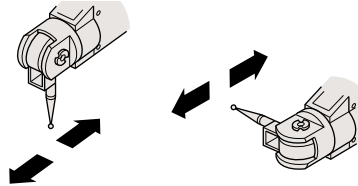

- Universal application to all directions. Not only the direction of the measuring point, but also the direction of measurement itself can be adjusted 360 degrees without moving the indicator.




513-304GE

SPECIFICATIONS

Metric		Graduation	Range	Accuracy	Dial reading	Measuring force		—	—	—	—	—
Order No.	Order No.	Graduation	Range	Accuracy	Dial reading	Measuring force		—	—	—	—	—
Basic set	Full set											
513-304GE	513-304GT	0.01 mm	0.8 mm	8 µm	0-40-0	0.3 N or less	✓	—	—	—	—	—

Inch		Graduation	Range	Accuracy	Dial reading	Measuring force		—	—	—	—	—
Order No.	Order No.	Graduation	Range	Accuracy	Dial reading	Measuring force		—	—	—	—	—
Basic set	Full set											
513-302G	513-302GT	0.0005 in	0.03 in	±0.0005 in	0-15-0	0.3 N or less	✓	—	—	—	—	—

 Carbide contact point (Slightly magnetic)

DIMENSIONS

